

Draft for USEPA and MDNRE Review

Mr. Samuel Borries USEPA Region 5 77 West Jackson Boulevard (SE-5J) Chicago, IL 60604-3507

Subject:

Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site Time-Critical Removal Action – Former Plainwell Impoundment Discontinuation of Groundwater Monitoring Program

Dear Mr. Borries:

Four quarters of groundwater data are now available for the former Plainwell Impoundment. The analytical results from the most recent round of sampling – conducted in December 2009 – were all non-detect for polychlorinated biphenyls (PCBs).

As described in our December 9, 2009 letter titled Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site Time-Critical Removal Action – Former Plainwell Impoundment 2009 Q1-3 Groundwater Sampling Results (Garbaciak 2009), now that four quarters of PCB groundwater data are available – a total of 82 samples, all of which were non-detect for PCBs – ARCADIS is requesting United States Environmental Protection Agency (USEPA) approval to discontinue groundwater sampling in the former Plainwell Impoundment and permanently abandon all 15 monitoring wells according to applicable standards of the Michigan Department of Natural Resources and Environment (MDNRE). Information to support USEPA's consideration of this request – including details of the installation, approach, and results available from the first three quarters of sampling – are described in the December 9, 2009 letter (Garbaciak 2009), and the results of the fourth sampling event are summarized below.

Background

Georgia-Pacific LLC installed a network of 15 groundwater monitoring wells and five staff gauges in the former Plainwell Impoundment in accordance with the approved Former Plainwell Impoundment Time-Critical Removal Action Design Report (TCRA Design Report; ARCADIS BBL 2007a) and the Supplemental Remedial Investigation/Feasibility Study Work Plan – Morrow Dam to Plainwell Dam (Area 1 SRI/FS Work Plan; ARCADIS BBL 2007b). Quarterly monitoring and sampling events were carried out in April, June, September, and December 2009. A description of the installation of the well network and staff gauges, the goals of the groundwater investigation, the monitoring approach, and the first three quarters

ARCADIS
30 West Monroe
Suite 1710
Chicago
Illinois 60603
Tel 312.332.4937
Fax 312.332.4434
www.arcadis-us.com

Date:

January 25, 2010

Contact

Steve Garbaciak

Phone

312.332.4937 x12

Email:

Steve.Garbaciak@ arcadis-us.com

Our ref:

B0064539.0000.00500

US EPA RECORDS CENTER REGION 5



Draft for USEPA and MDNRE Review

Mr. Samual Borries January 25, 2010

monitoring and sampling data were included in the December 9, 2009 letter (Garbaciak 2009). Results from the fourth quarter sampling event are described below.

December 2009 Sampling Results

Prior to the sampling event, groundwater and surface water elevations were monitored for a period of two weeks to verify the direction of water flow. The data confirmed flow was toward the river. Data from the December 2009 sampling event are tabulated in Tables 1 and 2.

Groundwater and surface water samples were collected during the week of December 14, 2009. Groundwater samples were collected using ultra-low flow sampling techniques. Surface water samples were collected from the river near Staff Gauge 5 (SG-5, see Figure 1) on the first day and last day of groundwater sampling activities. Sampling logs are included in Attachment 1.

ARCADIS collected a total of 15 groundwater samples (excluding duplicate samples) during the December 2009 sampling event. All samples were submitted to Test America Labs in Burlington, Vermont for the following analyses (sample analytical methods to be consistent with the *Multi-Area Quality Assurance Project Plan for the Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site, Revision 1* [Multi-Area QAPP, ARCADIS 2009]):

- Total PCBs by Aroclor
- Total Organic Carbon
- Total Dissolved Solids and Total Suspended Solids
- Chloride, Sulfate, Alkalinity, Sodium, Potassium, Magnesium, and Calcium

Consistent with the Multi-Area QAPP, one blind duplicate sample was collected for every 10 samples of each sample matrix for all analytical parameters, and one matrix spike/matrix spike duplicate sample was collected for every 20 samples analyzed for PCBs.

The Michigan Department of Environmental Quality (MDEQ, now part of the Michigan Department of Natural Resources and Environment [MDNRE]) also collected seven split samples – these samples were submitted to Northeast Analytical Labs in Detroit, Michigan for PCB analysis. MDEQ samples were not analyzed for inorganic constituents. MDEQ's laboratory-validated split sample PCB results were sent to ARCADIS on January 19, 2010 (Santini 2010).

Draft for USEPA and MDNRE Review

Mr. Samual Borries January 25, 2010

PCBs were not detected in any of the December 2009 groundwater samples collected by ARCADIS or MDEQ at quantitation limits ranging from 0.025 micrograms per liter (μ g/L) for Northeast Analytical Labs to 0.047 to 0.051 μ g/L for Test America Labs.

PCB analytical results for all samples (including MDEQ's split samples) collected during the December 2009 sampling event are summarized in Table 3, and analytical results for inorganic constituents are summarized in Table 4. Full validation packages for the samples collected by ARCADIS are included in Attachment 2, and copies of analytical reports for MDEQ samples are included in Attachment 3.

Request to Discontinue Sampling

As described in the TCRA Design Report and Area 1 SRI/FS Work Plan, the groundwater monitoring program was designed to include eight quarterly sampling events over a two-year period.

Four of the quarterly sampling events are now complete. We believe these results indicate that PCBs are not present in groundwater, and that it is reasonable to conclude that PCBs are not of concern in groundwater in the former Plainwell Impoundment. Pursuant to Section 27 Paragraph 75 of the Administrative Settlement Agreement and Order on Consent for Removal Action, we formally request USEPA approval to discontinue groundwater sampling at all wells in the former Plainwell Impoundment and permanently abandon the monitoring wells according to applicable State of Michigan standards. Please contact Doug Cowin (312.332.4937 x 11) or me if you would like to discuss this issue further.

Sincerely,

ARCADIS

Stephen Garbaciak Jr., P.E. Vice President

Enclosures

Draft for USEPA and MDNRE Review

Mr. Samual Borries January 25, 2010

Copies:

James Saric, USEPA
Paul T. Bucholtz, MDNRE
Sharon Hanshue, MDNRE
Jeff Keiser, CH2M Hill
J. Michael Davis, Esq., Georgia-Pacific LLC
Garry Griffith, P.E., Georgia-Pacific LLC
Mark P. Brown, Ph.D., Waterviews LLC
Michael J. Erickson, P.E., ARCADIS
Douglas K. Cowin, P.G., ARCADIS
Martin Lebo, Weyerhaeuser Company
Richard Gay, Weyerhaeuser Company
Kathy Huibregtse, RMT Inc.

Draft for USEPA and MDNRE Review

Mr. Samual Borries January 25, 2010

Tables

- Table 1 December 2009 Groundwater and Surface Water Readings
- Table 2 December 2009 Groundwater and Surface Water Elevations
- Table 3 Summary of PCB Samples Collected and Data Received for December 2009 Sampling Event
- Table 4 Summary of Inorganic Samples Collected and Data Received for December 2009 Sampling Event

Figure

Figure 1 – Groundwater Monitoring Well Location Map

Attachments (electronic only - included on attached CD)

Attachment 1 - December 2009 Groundwater and Surface Water Sampling Logs

Attachment 2 - December 2009 Validation Packages

Attachment 3 - December 2009 Analytical Reports for MDEQ Split Samples

References

- ARCADIS BBL. 2007a. Former Plainwell Impoundment Time-Critical Removal Action Design Report. February 2007.
- ARCADIS BBL. 2007b. Supplemental Remedial Investigation/Feasibility Study Work Plan Morrow Dam to Plainwell (Area 1 SRI/FS Work Plan). February 2007.
- ARCADIS. 2009. Multi-Area Quality Assurance Project Plan for the Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site, Revision 1. November 2009.
- Garbaciak, S, 2009. Letter from Stephen Garbaciak Jr., P.E. (ARCADIS) to Samuel Borries (USEPA), Paul Bucholtz (MDEQ), and Sharon Hanshue (MDNR) re: Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site Time-Critical Removal Action Former Plainwell Impoundment 2009 Q1-3 Groundwater Sampling Results. December 9, 2009.
- Santini, A. 2010. Electronic transmittal of Plainwell TCRA oversight PCB analytical results for groundwater samples collected in December 2009 from Drew Santini, Camp Dresser McKee to Doug Cowin, ARCADIS. January 19, 2010.

Tables

Georgia-Pacific LLC Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site Former Plainwell Impoundment TCRA Quarterly Post-Construction Groundwater Monitoring - Quarter 4

Table 1 - December 2009 Groundwater and Surface Water Readings

| Location | Coord | nates 1 | Reference | Staff Gage W | Staff Gage Water Elevations/Monitoring Well Depth to Water | | | | | | | | | |
|-----------------------|---------------|--|----------------------------|-----------------|--|----------------------|----------------------|--|--|--|--|--|--|--|
| rocation | Northing | Easting | Elevation ^(2,1) | 12.01.09 | 12.03.09 | 12.07.09 | 12.09.09 | | | | | | | |
| Profession in | e e 1913度新聞 | | ~~~ ~~~ | taff Gages | vijvat, 49c., t | Alberta Polaria (h.) | virialijo prepara | | | | | | | |
| SG-1 | 350394.4 | 12775769.3 | - | 707.03 | 707.10 | 707.15 | 707.24 | | | | | | | |
| SG-2 | 350979.9 | 12772024.3 | - | 700.15 | 700.22 | 700.27 | 700.34 | | | | | | | |
| SG-3 | 350360.5 | 12772101.6 | - | - | | - | - | | | | | | | |
| SG-4 | 350988.8 | 12772385.0 | • | 700.50 | 700.55 | 700,58 | 700.62 | | | | | | | |
| SG-5 | 350076.1 | 12773475.4 | - | 702.08 | 702.15 | 702.17 | 702.20 | | | | | | | |
| Section of the second | Salt man best | \$\$ 1981 TO 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | Mon | itoring Wells 🧦 | Station . Sugar | GRAY VERZON | Wilder Brook Brokers | | | | | | | |
| MW-1 | 350961.38 | 12772432.61 | 708.92 | 8.12 | 8.12 | 8.10 | 8.05 | | | | | | | |
| MW-2 | 350711.55 | 12772517.19 | 712.32 | 11.33 | 11.32 | 11.31 | 11.26 | | | | | | | |
| MW-3 | 350339.20 | 12772701.62 | 711.66 | 10.21 | 10.20 | 10.19 | 10.14 | | | | | | | |
| MW-4 | 350154.43 | 12773098.22 | 713.54 | 11.61 | 11,61 | 11.59 | 11.54 | | | | | | | |
| MW-5 | 350154.29 | 12773466.74 | 713.69 | 11.42 | 11.40 | 11.39 | 11.35 | | | | | | | |
| MW-6 | 350846.49 | 12772491.10 | 712.07 | 11.21 | 11.20 | 11.19 | 11.19 | | | | | | | |
| MW-7 | 350555.17 | 12772534.59 | 712.85 | 11.65 | 11.65 | 11.63 | 11.59 | | | | | | | |
| MW-8 | 350171.40 | 12772825.18 | 711.85 | 10.27 | 10.26 | 10.25 | 10.20 | | | | | | | |
| MW-9 | 350900.48 | 12773169.10 | 717.09 | 15.11 | 15.11 | 15.09 | 15.08 | | | | | | | |
| MW-10 | 350302.97 | 12774069.99 | 712.72 | 8.96 | 8.95 | 8.95 | 8.85 | | | | | | | |
| MW-11 | 350789.24 | 12774553.73 | 712.38 | 7.98 | 7.97 | 7.96 | 7.90 | | | | | | | |
| MW-12 | 350726.89 | 12775210.90 | 715.35 | 9.75 | 9.74 | 9.74 | 9.60 | | | | | | | |
| MW-13 | 350420.23 | 12774429.71 | 714.36 | 9.71 | 9.70 | 9.71 | 9.63 | | | | | | | |
| MW-14 | 350664.31 | 12774948.40 | 712.45 | 7.43 | 7.43 | 7.43 | 7.35 | | | | | | | |
| MW-15 | 350412.99 | 12774893.18 | 713.83 | 8.55 | 8.54 | 8.55 | 8.45 | | | | | | | |

Notes:

1 Coordinates are based on the North American Datum of 1983, Michigan South Zone.

² Water elevations at staff gages are based on the National Geodetic Vertical Datum of 1929.

³ Monitoring well depth to groundwater measured in feet. Elevation of the top of the well's inner casing was used as reference.

Georgia-Pacific LLC
Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site
Former Plainwell Impoundment TCRA

Quarterly Post-Construction Groundwater Monitoring - Quarter 4

Table 2 - December 2009 Groundwater and Surface Water Elevations

| Location | Water Level Elevation / Date | | | | | | | | | | | | |
|--|------------------------------|----------------------|-------------------------|--------------------|--|--|--|--|--|--|--|--|--|
| | 12.01.09 | 12.03.09 | 12.07.09 | 12.09.09 | | | | | | | | | |
| ととき等のできる時期機能を見ない。 | Sta . | ff Gages | programme with the fig. | the second section | | | | | | | | | |
| SG-1 | 707.03 | 707.10 | 707.15 | 707 24 | | | | | | | | | |
| SG-2 | 700.15 | 700.22 | 700.27 | 700.34 | | | | | | | | | |
| SG-3 ¹ | | - | | | | | | | | | | | |
| SG-4 | 700.50 | 700.55 | 700 58 | 700.62 | | | | | | | | | |
| SG-5 | 702 08 | 702.15 | 702.17 | 702 20 | | | | | | | | | |
| The second of th | Monit | oring Wells | ANGEORGE OF THE | Oncerentations : | | | | | | | | | |
| · MW-1 | 700.80 | 700.80 | 700.82 | 700.87 | | | | | | | | | |
| MW-2 | 700.99 | 701.00 | 701.01 | 701.06 | | | | | | | | | |
| MW-3 | 701.45 | 701.46 | 701.47 | 701.52 | | | | | | | | | |
| MW-4 | 701.93 | 701.93 | 701.95 | 702.00 | | | | | | | | | |
| MW-5 | 702 27 | 702.29 | 702.30 | 702.34 | | | | | | | | | |
| MW-6 | 700.86 | 700.87 | 700 88 | 700.88 | | | | | | | | | |
| MW-7 | 701.20 | 701.20 | 701.22 | 701.26 | | | | | | | | | |
| MW-8 | 701.58 | 701.59 | 701 60 | 701.65 | | | | | | | | | |
| MW-9 | 701 98 | 701.98 | 702.00 | 702.01 | | | | | | | | | |
| MW-10 | 703.76 | 703.77 | 703.77 | 703.87 | | | | | | | | | |
| MW-11 | 704.40 | 704.41 | 704.42 | 704 48 | | | | | | | | | |
| MW-12 | 705.60 | 705.61 | 705 61 | 705.75 | | | | | | | | | |
| MW-13 | 704.65 | 704.66 | 704 65 | 704.73 | | | | | | | | | |
| MW-14 | 705.02 | 705.02 | 705.02 | 705.10 | | | | | | | | | |
| MW-15 | 705 28 | 705.29 | 705.28 | 705.38 | | | | | | | | | |
| roundwater "Surface Water Grad | lents (ft/ft) (positive p | radient indicates gr | oundwater flow to rh | ver) | | | | | | | | | |
| MW-5 - SG-5 | 0.19 | 0.14 | 0.13 | 0.14 | | | | | | | | | |
| MW-1 - SG-4 | 0.30 | 0 25 | 0.24 | 0.25 | | | | | | | | | |

Notes:

* Staff gauge SG-3 was not read during the December 2009 sampling event because ARCADIS did not have access to the private property where SG-3 is located.

Georgia-Pacific LLC
Allied Paper, Inc./Portage Creek/Kalamazoo River Superfund Site
Former Plainwell Impoundment TCRA
Quarterly Post-Construction Groundwater Monitoring - Quarter 4

Table 3 — Summary of PCB Samples Collected and Data Received for December 2009 Sampling Event

GSI Criteria

| 0G-0 | 20 1 | | WW-15 | MW-14 | MW-13 | 71.44141 | CL WAY | MW-11 | | MW-10 | | WW-9 | MW-8 | MW-7 | O-AAIM | NAM S | MW-5 | MW-4 | C. salai | E-May | MW-2 | 1-4410 | | | | | Panation | Californ | Campio |
|------------|--|-----------------------|------------|------------|------------|-------------|------------|------------|-------------|-------------|------------|------------|------------|-------------------|------------|------------|------------|------------|-------------|----------------------|------------|-------------|------------|------------------|-----|---------------------|----------|--------------|------------------------------------|
| 40/46/2000 | 12/14/2009 | | 12/15/2009 | 12/14/2009 | 12/15/2009 | 12/14/2009 | 12/14/2009 | 12/15/2009 | 12/16/2009 | 12/16/2009 | 12/16/2009 | 12/18/2009 | 12/16/2009 | 12/17/2009 | 12/17/2009 | 12/17/2009 | 12/16/2009 | 12/16/2009 | 12/17/2009 | 12/17/2009 | 12/17/2009 | 12/18/2009 | 12/18/2009 | | | | | Date | |
| TERRORA | TS31009 [TS31010] | | TS40055 | TS40052 | TS40054 | PGW-MW12-01 | TS40051 | TS40053 | PGW-MW10-02 | PGW-MW10-01 | TS40056 | TS40067 | TS40059 | TS40062 [TS40063] | PGW-MW6-01 | TS40065 | TS40057 | TS40058 | PGW-MW20-01 | T\$40060 [T\$40061]* | TS40064 | PGW-MW1-013 | TS40066 | | | | | Sample ID | |
| | 0.048 U [0.048 U] | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U [0.047 U] | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | | NA | | Jug/L | Aroclor-1016 | |
| 0.04911 | 0.048 U [0.048 U] | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U [0.047 U] | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | | NA | Groundwater Su | Hg/L | Arocior-1221 | |
| | 0.048 U [0.048 U] | Surface Water Semples | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U 0.047 U] | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | Groundwater Same | NA | riace Water interfa | 19/L | Aroclor-1232 | Pa |
| 0.04911 | 0.048 U [0.048 U] | phas? | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U [0.047 U] | 0.025 U | 0.048 U | 0.047 UJ | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | ing ? | NA | on Critoria & RBSL | hgr | Aroclor-1242 | rameter, Unit, a |
| 0.04011 | 0.048 U [0.048 U] 0.048 U [0.048 U] 0.048 U [0.048 U] 0.048 U [0.048 U] 0.048 U [0.048 U | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U [0.047 U] | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | | NA | - | 1/grt | Arocior-1248 | Parameter, Unit, and Concentration |
| 0.04911 | 0.048 U [0.048 U] | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0,048 U | 7 U | 0.025 U | 0.048 U | 0.047 UJ | 0.048 U | 0.025 U | In 8 | 0.048 U | 0.025 U | 0.048 U | | NA | | TyBri | Aracior-1254 | on |
| 0.04911 | 0.048 U [0.048 U] | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.04 | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | | NA | | 1/g/L | Arocior-1260 | |
| 0.049 U | 0.048 U [0.048 U] | | 0.051 U | 0.049 U | 0.049 U | 0.0255 U | 0.048 U | 0.048 U | 0.025 U | 0.025 U | 0.047 U | 0.051 U | 0.048 U | 0.048 U [0.047 U] | 0.025 U | 0.048 U | 0.047 U | 0.048 U | 0.025 U | 0.048 U [0.048 U] | 0.048 U | 0.025 U | 0.048 U | | 0.2 | | 1/gr | Total PCB | |

Notes:

12/18/2009 TS31011 0.049 U 0.0

MDEQ collected a trip blank (PGW-MWZQ-01) that was analyzed by NEA. This was not a spit sample; therefore, it does not appear in the table above. Analytical results for this trip blank are reported in the analytical package associated with MDEQ's samples, included as Atlactment 3.

J - The compound was positively identified; however, the associated numerical value is an estimated concentration only. U - Compound analyzed but not detected at a concentration above the reporting limit.

MDEQ - Michigan Department of Environmental Quality
MW - Monitoring Well
NEA - Northeastern Analytical Labs
PCB - Polychthorhaded Biphenyl
RBSL - Risk Based Screening Level
RBSL - Risk Based Screening Level
RBD - Remediation Redevelopment Division
SG - Staff Gauge
pg/L - microgram per liter

Georgia-Pacific LLC Allied Paper, Inc./Portage Creek/Kalamazco River Superfund Site Former Plainwell Impoundment TCRA Quarterly Post-Construction Groundwater Monitoring - Quarter 4 Table 4 — Summary of Inorganic Samples Collected and Data Received in December 2009


| | 6 | Care C | | MW-14 | - MW-13 | MW-12 | 11-WM | MW-10 | WM | B-WM | WW. | 9-WW | WW | MW-4 | MW-3 | MW-2 | 1-WW | | Section 2 | Sample | Ž. |
|------------|-------------------|---|------------|------------|--------------|------------|------------|------------|------------|------------|-------------------|------------|-------------------|------------|-------------------|------------|-------------|---------------------|--------------|----------------------------------|------------------------------------|
| - | , | | WW-15 | Ц | -13 | -12 | | -10 | WW-9: ∾: | 8-1 | MW 7 | /-6 | MW-5 | 4 | 3 | | | | 4 | 9 9 | :- :- |
| 12/18/2009 | 12/14/2009 | | 12/15/2009 | 12/14/2009 | 12/15/2009 | 12/14/2009 | 12/15/2009 | 12/16/2009 | 12/18/2009 | 12/16/2009 | 12/17/2009 | 12/17/2009 | 12/16/2009 | 12/16/2009 | 12/17/2009 | 12/17/2009 | 12/18/2009 | | 也等號 | Date | |
| TS31011 | TS31009 [TS31010] | | TS40055 | TS40052 | >>> TS40054 | TS40051 | TS40053 | TS40056 | TS40067 | TS40059 | TS40062 [TS40063] | TS40065 | TS40057 | TS40058 | TS40060 [TS40061] | TS40064 | TS40066 · · | | | Sample ID | . 202 |
| 86,600 | 90,100 [87,000] | | ~ 91,300≎ | 154,000 | 108,000 | 225,000 | 108,000 | 221,000 | *:: 83.400 | 108.000 | 135,000 [142,000] | 118,000 | *:3:197,000 %:4 × | 170.000 | 136,000 [134,000] | 153,000 | 348,000 | | 164 | Calcium | A |
| 24,400 | 25,600 [24,600] | | 23,200 | 36.000 | 25.700 | 48,900 | 25,000 | 26,900 | 21,900 | 27,300 | 29,600 [31,200] | 24,400 | 44,400 | 40,800 | 31,700 [31,300] | 30.200 | 121,000 | |) Jug/L | Magnesium | |
| 2,130 B | 2.240 B [2.220 B] | Surface | 2,430 B | 892 B | , ৯% 1,760 B | 6.650 | 1,840 B | 1,300 B | 1.830 B | 1,810 B | 1,590 B [1,670 B] | 1,530 B | :3,310 B | 2,080 B | 1.930 B [1,980 B] | 1,770 B | 5,050 | Groundwater Samples | - JOLEVAN | Potassium | |
| 35,000 | 40,000 [38,500] | Surface Water Samples | 62,500 | 41,800 | 75,800 | 15,700 | 48,700 | 45,900 | 72,500 | 93,200 | 72,800 [76,900] | 72,600 | € 68,300 :** | 82,900 | 72,600 [71,700] | 72,200 | 48,800 | water Gamples | T. T. T. | Bodium | Paramete |
| 230 | 230 [230] | 经过过的通过 | 280 | 240 | Ŀ | 450 | 260 : | 400 | 260 | 270 | 300 [300] | 270 | ∴ 390 | 320 | 330 (320) | 330 | > #7 320 | i. | mg/L · | Alkathrity | r, Unit, and C |
| 61 | 58 [69] | | 63 | 60 | ÷.⊴:.110 | 14 | 2 | 71 | æ | 160 | 140 [140] | 130 | 26 | 130 | 120 [130] | 140 | 51 | | mg/L*33# | Chlorida | Parameter, Unit, and Concentration |
| 36 J | 29 [34] | | 42 | 460 | 25 | 190 | . 55 | 180 | 38 | 56 | 96 [97] | 75 | 200 | 230 | 81 [89] | 120 | 910 | をはない。 | 10mg/2 | Suffeta | Ď |
| 402 | 411 [399] | 1. 25335. | 421 | 691 | 落层 447 -0. | 872 | 479 | 856 | 458 | 630 | 697 [691] | 577 | 884 | 883 | 678 [686] | 708 | 1.870 | | THE MIDELLES | Total Dissolved Solids | |
| 5.4 | 4.5 [4.6] | 10 to | 1. | 2.6 | 2.4 | 31.3 | 2.5 | 16.8 | 2.2 | 1.6 | 3.8[4] | 3.9 | 6.9 | 4 | 3.6 [3.8] | 4.9 | 9.1 | No. of the second | Tight . | Total Organic Carbon | |
| 5 | 5.5 [5] | | 8.2 | 178 | 15.2 | 0.7 | 13.6 | 14.5 | 4.3 | 8.9 | 14.6 [14.9] | 16.1 | 15.7 | 16.8 | 12.9 [13.9] | 21.5 | 34.2 | | mg/L | Suspended Suspended Solids | |

All samples analyzed by Test America Laboratory.

Duplicate samples are shown in brackets.
B - Indicates an estimated value between the instrument detection limit and the Reporting Limit (RL).
J - The compound was positively identified; however, the associated numerical value is an estimated concentration only.

MW - Monitoring well SG - Staff Gauge mg/L - milligram per liter µg/L - microgram per liter

Figure

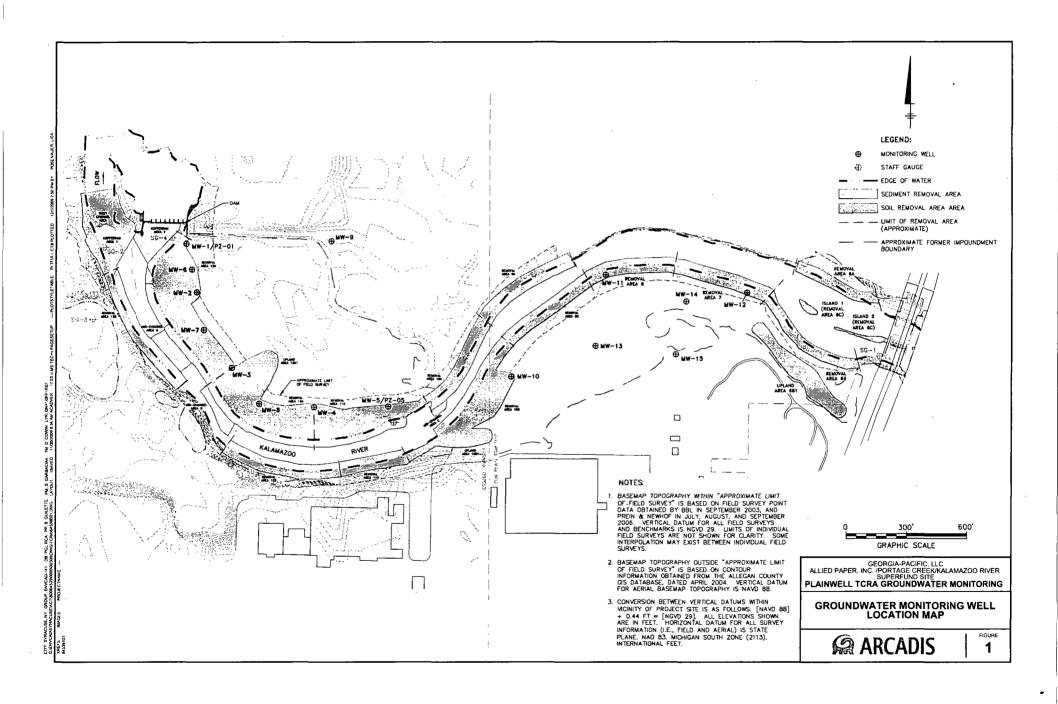

Attachments (electronic only included on attached CD)

Attachment 1: December 2009 Groundwater and Surface Water Sampling Logs

Attachment 2: December 2009 Validation Packages

Attachment 3: December 2009 Analytical Reports for MDEQ Split Samples